For the complete PDF manual
please visit www.LaserPros.com.

HEWLETT PACKARD

Color LaserJet™

8550 Printer

Copy Module
Automatic Document Feeder
High-Capacity Input
Service Manual

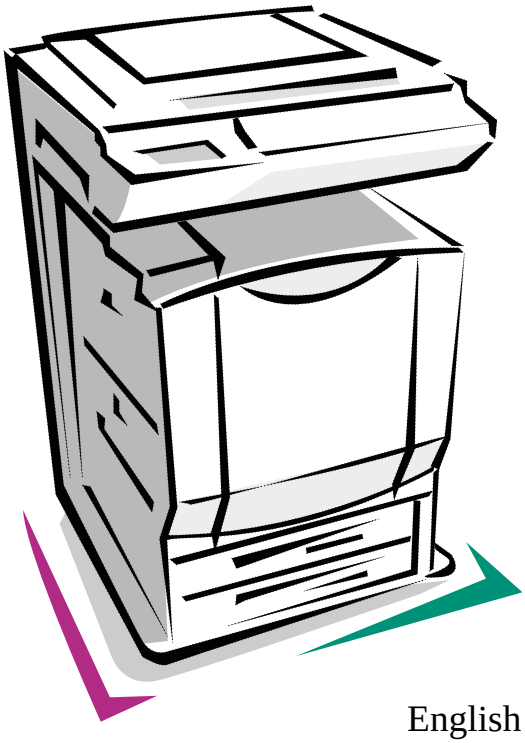

English

HP Copy Module, ADF, and side HCI for HP Color LaserJet 8550 series printers

Service Manual

Copyright Information

Copyright © 2002 Hewlett-Packard Company

All Rights Reserved. Reproduction, adaptations, or translation without prior written permission is prohibited except as allowed under copyright laws.

Part number C7834-90902

Second edition, February 2002

Printed in USA

Warranty

The information contained in this document is subject to change without notice.

Hewlett-Packard makes no warranty of any kind with respect to this information. HEWLETT-PACKARD SPECIFICALLY DISCLAIMS THE IMPLIED WARRANTY OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE.

Hewlett-Packard shall not be liable for any direct, indirect, incidental, consequential, or other damage alleged in connection with the furnishing or use of this information.

NOTICE TO U.S. GOVERNMENT USERS: RESTRICTED RIGHTS COMMERCIAL COMPUTER SOFTWARE: “Use, duplication, or disclosure by the Government is subject to restrictions as set forth in subparagraph (c) (1)(ii) of the Rights in Technical Data Clause at DFARS 52.227-7013.

Trademark Credits

CompuServe™ is a U.S. trademark of CompuServe, Inc.

MS-DOS® is a U.S. registered trademark of Microsoft Corporation.

Photoshop™ and PostScript® are registered trademarks of Adobe Systems Incorporated.

TrueType™ is a U.S. trademark of Apple Computer, Inc.

UNIX® is a registered trademark in the United States and other countries, licensed exclusively through X/Open Company Limited.

Safety Information

WARNING
Electrical Shock Hazard

To avoid electrical shock, use only supplied power cords and connect only to properly grounded (3-hole) wall outlets.

Hewlett-Packard Company
11311 Chinden Boulevard
Boise, Idaho 83714 U.S.A.

Contents

1 Product information

Chapter contents 21
Introduction 23
Copy module 23
Automatic document feeder (ADF) 28
Side high-capacity input (side HCI) 32
Model and serial numbers 35
Safety and regulatory information 35

2 Service approach

Chapter contents 37
Service approach overview 39
Parts and supplies 39
Ordering 40
Technical assistance 42
Warranty 46

3 Operational overview

Chapter contents 47
Control panel 49
Copy module functionality 51
Self-diagnostic messages 59
Service mode 60

4 Adjustments and maintenance

Chapter contents 117
Overview 119
MFP print engine adjustments 119
Copy module adjustments 121
ADF adjustments 140
Side HCI adjustments 159
Periodically replaced parts 163
Cleaning 164
Lubricating 174

5 Theory of operation

Chapter contents 175
Introduction 177
Notes on the power switch 177
Copy module 178
ADF 244
Side HCI 304

6 Removal and replacement

Chapter contents 327
Required tools 331
Repair notices 332
Copy module 333
Automatic document feeder (ADF) 377
Side HCI 434

7 Troubleshooting

Chapter contents 455
System-to-device troubleshooting 457
Copy module troubleshooting 460
ADF troubleshooting 528
Side HCI troubleshooting 535

8 Parts and diagrams

Chapter contents 547
How to use this chapter 551
Printer parts unique to the HP Color LaserJet 8550MFP 552
Stand 555
Copy module 558
ADF 600
Side HCI 649
Numerical parts list 672
Alphabetical parts list 680

Index

For the complete PDF manual
please visit www.LaserPros.com.